

iSCAN211 Bluetooth Handheld Barcode Scanner



- Reads all standard 1D and stacked PDF barcodes
- ATEX / IECEx Zones 1, 2, 21, and 22 certified
- RS232/422 or USB interface
- IP65 fully ruggedised

Maximum mobility

Read barcodes wherever you need with wireless operation and Bluetooth link. Hazardous area recharging is also available, helping the iSCAN211 fit seamlessly with your work patterns

Increased productivity and throughput with high speed scanning

The iSCAN211 records barcodes quickly and accurately, reaching speeds of up to 60 scans per second.

Great for hard to reach locations

The scan line is wider than conventional laser scanners, making it easier to see. Combined with the long reading distance, this makes it simple to read barcodes, even in awkward areas. The iSCAN211 also works effectively in bright sunlight, up to 100,000 lux.

Easy to use

Ergonomic grip and lightweight, well balanced body make the iSCAN211 easy to carry with you.

Read feedback

Visual, audio, and vibration feedback lets the user know when a scan is successful, even in noisy industrial environments.

Highly reliable

No need to worry about dropping the scanner; rigorously tested, the iSCAN211 can withstand 50 drops onto concrete from a height of 2m.

Code types read by the iSCAN211:

Bar code types:

Codabar, Code 39, Code 32, UPC-A, UPC-E, Standard and Industrial 2 of 5, Interleaved & Matrix 2 of 5, Code 128, UCC/EAN-128, Code 11, Code 93, German ITF Postal Code, Mainland China Postal Code, Telepen, MSI/Plessey, UK/Plessey, Limited/Expanded GS1 DataBar

Stacked code types:

PDF417, MicroPDF417, Code 49, Code 16K, Composite, Codablock F



Extronics Limited

1 Dalton Way, Midpoint 18, Middlewich, Cheshire, UK. CW10 0HU

Tel: +44 (0) 845 277 5000 Fax: +44 (0)845 277 4000 E-mail: info@extronics.com Web: www.extronics.com

414875-3.1

Specification

Certification	<ul style="list-style-type: none"> ⊕ II 2G Ex ib IIB T4 ⊕ II 2G Ex ib IIB T4 Gb ⊕ II 2D Ex ib IIIC T135°C ⊕ II 2D Ex ib IIIC T135°C Db
Dimensions	H185 x L104 x W76 mm
Weight	260g (including battery)
Ingress protection	IP65
Bluetooth	V4.0, 2.402 ... 2.4830 GHz Wireless operating range up to 100 m (free view), batch function for expansion of the wireless radius, up to seven scanners communicate with one base station
Ambient operating temperature	-20°C to +50°C
Humidity	± 95 %, non condensing
Ambient light resistance	100,000 lx
Scanning frequency	60 Hz
Light source	Visible red light 630 nm
Reading distance	30 mm to 380mm
User feedback signals	2 LEDs (operation status and read feedback) Audio beeper Vibration
Base station interface	RS232/RS422 or USB
Battery	Lithium-ion battery, 3.6V, 2250mAh
Operating voltage	4.9V, supplied via iSCANPS

Required accessories

+ compatible base station or charging station (if connecting the Bluetooth scanner to an alternative Bluetooth device e.g. tablet, a base station may not be required. However, a charging station is still necessary. A base station also acts as a charging station)

+ compatible power supply (iSCANPS if using the base station in the hazardous area; iSCAN2xxBLP if using a base or charging station in the safe area)

+ compatible cable to connect base station to power supply



Extronics Limited


1 Dalton Way, Midpoint 18, Middlewich, Cheshire, UK. CW10 0HU

Tel: +44 (0) 845 277 5000 Fax: +44 (0)845 277 4000 E-mail: info@extronics.com Web: www.extronics.com

414875-3.1

System assembly

Hazardous area charging:

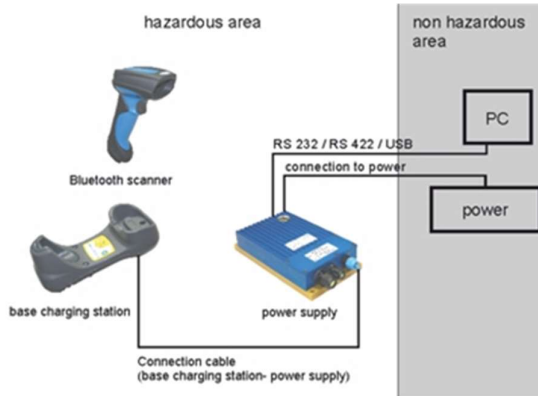

This assembly requires a base station (iSCAN211EXB), a power supply (iSCANPS), a connection cable between the two (iSCAN2XXCAB5, 6, 7, 8, 9, or 10), and connections between the power supply and a PC (not supplied by Extronics).

External connection cable requirements:

Data cable


USB: 0.2 – 2.5 mm², 4-wire

RS232: 0.2 – 2.5 mm², 3-wire

Power supply cable

0.2 – 2.5 mm², 3-wire

Safe area charging:

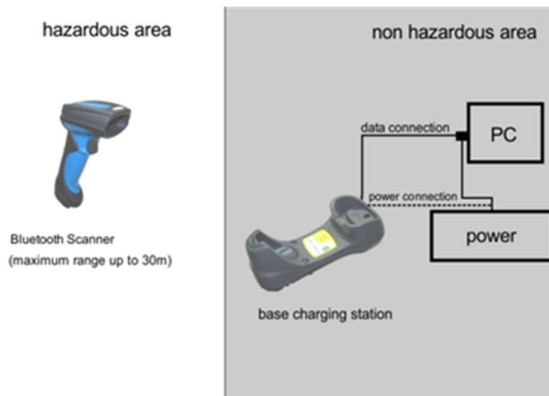

This assembly requires a non-Ex base or charging station (iSCAN211B or BNOBT).

If connecting the base or charging station to a PC via USB, the USB cable (iSCAN2XXCAB3 or 4) can provide both data and power connections in one cable.

If connecting the base or charging station to a PC via RS232 (iSCAN2XXCAB1 or 2), this can only support data. The base or charging station will require an additional power connection (iSCAN2XXBLP).

Ordering Information

iSCAN211 Bluetooth handheld scanner, battery included, Zone 1. Reads 1D barcodes.	iSCAN211
iSCAN211 Bluetooth handheld scanner, battery included, Zone 1. Reads 1D and Stacked PDF barcodes.	iSCAN211PDF

Hazardous area charging:

Base station:

iSCAN211 base station, without cable, Zone 1	iSCAN211EXB
--	-------------

Power supply:

Power supply module, DC 24V, RS232, Zone 1	iSCANPS1
Power supply module, DC 24V, USB, Zone 1	iSCANPS2
Power supply module, AC 230V, RS232, Zone 1	iSCANPS3
Power supply module, AC 230V, USB, Zone 1	iSCANPS4

For more information on the power supply modules, please see the iSCANPS datasheet.



Extronics Limited

1 Dalton Way, Midpoint 18, Middlewich, Cheshire, UK. CW10 0HU

Tel: +44 (0) 845 277 5000 Fax: +44 (0)845 277 4000 E-mail: info@extronics.com Web: www.extronics.com

414875-3.1

Cable to connect base station and power supply:

Base station connection cable, RS232, 1.8m, Zone 1	ISCAN2XXCAB5
Base station connection cable, RS232, spiral, 3.8m, Zone 1	ISCAN2XXCAB6
Base station connection cable with voltage inhibitor, RS232, 1.8m, Zone 1	ISCAN2XXCAB7
Base station connection cable with voltage inhibitor, RS232, spiral, 3.8m, Zone 1	ISCAN2XXCAB8
Base station connection cable, USB, 1.8m, Zone 1	ISCAN2XXCAB9
Base station connection cable, USB, spiral, 3.8m, Zone 1	ISCAN2XXCAB10

Safe area charging:

Base or charging station:

iSCAN211 base station, without cable, non-Ex	ISCAN211B
iSCAN211 charging station, without Bluetooth, without cable, non-Ex	ISCAN211BNOBT

Cable to connect base or charging station and PC:

Base station connection cable, RS232, 1.8m	ISCAN2XXCAB1
Base station connection cable, RS232, spiral, 3.8m	ISCAN2XXCAB2
Base station connection cable, USB, 1.8m	ISCAN2XXCAB3
Base station connection cable, USB, spiral, 3.8m	ISCAN2XXCAB4

Power supply for base or charging station (required for RS232):

Power supply for base or charging station, DC 5V, non-Ex	ISCAN2XXBLP
--	-------------

Accessories:

Spare lithium ion battery for iSCAN211, Zone 1	ISCAN2XXBATT
--	--------------

Stands:

Tripod stand for iSCAN101 and 2x1	ISCANSTRI
Tabletop stand for iSCAN101 and 2x1	ISCANSTAB

Extension cables (RS232 only):

Extension cable with male connector, 6m, Zone 1	ISCANCC1
Extension cable with male connector, spiral, 4.5m, Zone 1	ISCANCC2

Please note that these extension cables may only be used with iSCAN101CAB1, 2, 5, 6, 7 or 8 options

